

Licensee	Perilya Broken Hill Limited (PBHL)
Address	Wentworth Rd, Broken Hill, NSW, 2880.
Environmental Protection Licence	2688 (Southern Operations)
Link to Environmental Protection Licence	<a href="http://www.epa.nsw.gov.au/prpoeoapp/ViewPOEOLicence.aspx?DOCID=31560&amp;SYSUID=1&amp;LICID=2688">http://www.epa.nsw.gov.au/prpoeoapp/ViewPOEOLicence.aspx?DOCID=31560&amp;SYSUID=1&amp;LICID=2688</a>
Reporting period	June 2017
Date report published on website	

## Environmental Protection Licence 2688

### Dust Deposition

Perilya Broken Hill Limited (PBHL) has nine (9) deposition dust gauge stations located at strategic points around the Southern Operations site (Figure 1). A summary of Environmental Protection Licence (EPL) 2688 conditions is shown in Table 1.



**Figure 1.** Location of the EPL 2688 deposition dust gauges associated with Perilya's Southern Operations.

**Table 1.** Summary of the EPL 2688 conditions for deposition dust gauges.

<b>Dust Gauges EPL 2688 Conditions</b>	
<b>Condition</b>	<b>Licence Requirement</b>
Licence Point	3,4,5,6,7,8,9,10,11
Pollutant/s	Particulates (deposited matter)
	Total Lead
Unit of measure	Grams per square meter per month (g/m <sup>2</sup> /month)
Sampling Method	AM-19
Monitoring frequency	Every 30 days ± two days
Data Reporting	Monthly

### **Dust Deposition Results**

June particulates – deposited matter and total lead results are presented in Table 2. Results of laboratory analyses were received by Perilya on the 10-07-2017.

**Table 2.** June dust deposition gauge results.

<b>Licence Point</b>	<b>Particulates – deposited matter (g/m<sup>2</sup>/month)</b>	<b>Total Lead (g/m<sup>2</sup>/month)</b>
3	1.8	0.006
4	<0.1	0.028
5	<0.1	0.029
6	<0.1	0.005
7	<0.1	0.012
8	<0.1	0.015
9	<0.1	0.01
10	<0.1	0.007
11	<0.1	0.008

### **High Volume Air Samplers**

PBHL currently operates two (2) high volume air samplers (HVAS) in relation to EPL 2688, both located at the Southern Operations site (Figure 2). HVAS sampling stations operate (sample) routinely for a 24-hour period every six (6) days on a regular basis.



**Figure 2.** Location of the HVAS associated with EPL 2688.

Table 3 provides a summary of EPL 2688 conditions.

**Table 3.** Summary of the EPL 2688 conditions for the HVAS samplers.

<b>High Volume Air Sampler EPL 2688 Conditions</b>	
<b>Condition</b>	<b>Licence Requirement</b>
Licence Point	12 and 13
Pollutant/s	Total Suspended Particulates Total lead (Pb)
Unit of measure	Micrograms per cubic meter ( $\mu\text{g}/\text{m}^3$ )
Sampling Method	AS 3580.9.15:2014 AS/NZS 3580.9.3:2015
Monitoring frequency	Every six days for 24 hours
Data Reporting	Every 6 days


### HVAS Results

Total suspended particulate (TSP) and total lead results are presented in Table 4. Monthly averages for TSP and total lead for the previous 12 months are shown in Figure 3 and Figure 4 respectively. The results for the HVAS monitoring were received on the 03-07-2017, 18-07-2017 and 21-07-2017.

**Table 4.** June HVAS total lead and TSP results.


Licence Point	Pollutant	No. times measured in the month	Min. value	Mean Value	Median Value	Max. Value
12	TSP ( $\mu\text{g}/\text{m}^3$ )	5	9.2	18.0	15.0	29.0
	Total Lead ( $\mu\text{g}/\text{m}^3$ )	5	0.0290	0.098	0.093	0.180
13	TSP ( $\mu\text{g}/\text{m}^3$ )	5	10.0	17.8	15.0	33.0
	Total Lead ( $\mu\text{g}/\text{m}^3$ )	5	0.0120	0.109	0.053	0.380

### Annual monthly average TSP (previous 12 months)

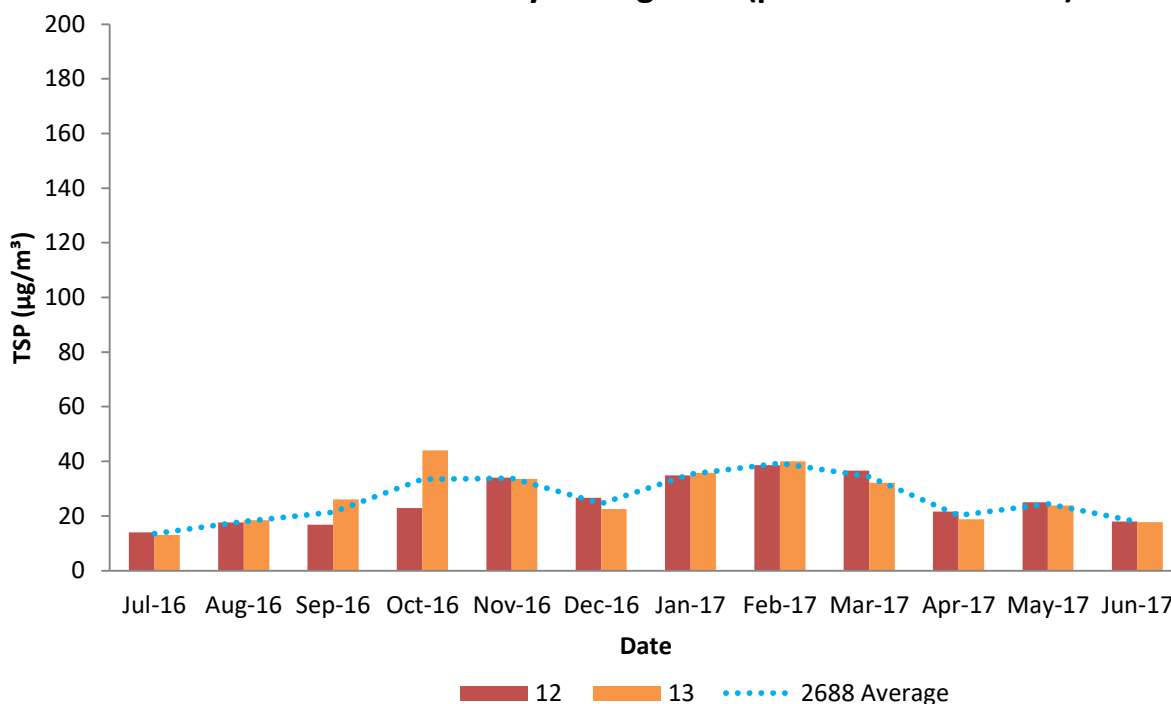

**Figure 3.** Average TSP results for the 12 months up to and including June.

### Annual monthly Total Lead average (previous 12 months)

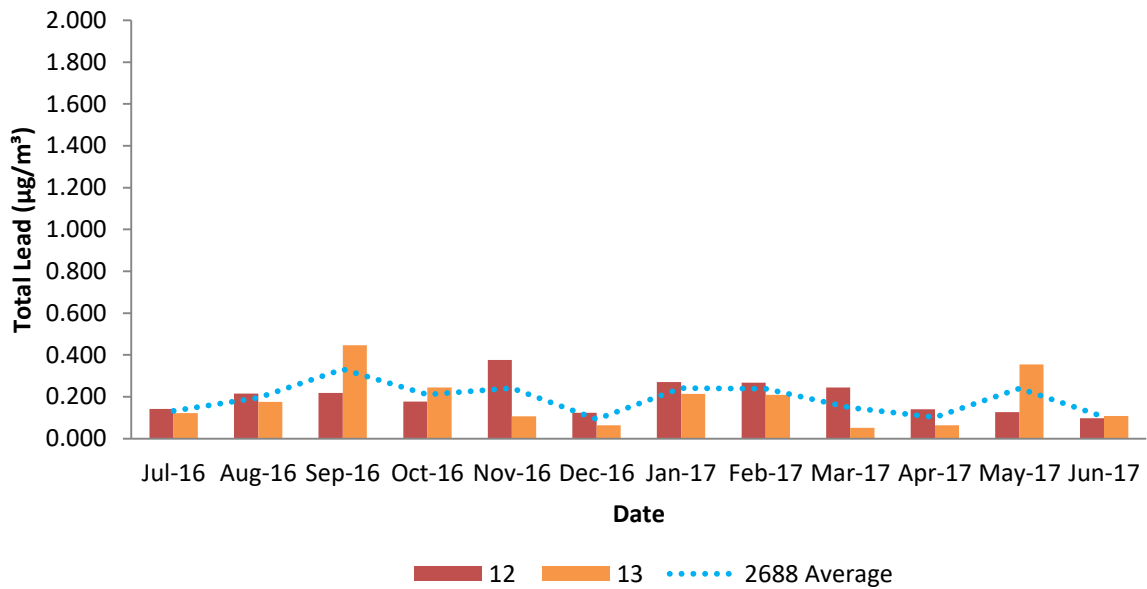

**Figure 4.** Average total lead results for the 12 months up to and including June.

### Water Quality

PBHL has two (2) licenced discharge points for surface waters, Licence Point 1 and Licence Point 2 (Figure 5). A summary of the licence conditions relating to discharges of waters from these two points is shown in Table 5.

A diversion drain was constructed in the last quarter of 2016 to ensure that water from Railway Town could pass through the Perilya Operation without being contaminated by mine water. A mechanism was installed to allow harvesting of this run off from residential areas when site water storage is low and the capture will benefit the operation.



**Figure 5.** Location of the EPL2688 licenced discharge points.

**Table 5.** Summary of the EPL 2688 conditions for licenced surface waters discharge points.

<b>Water EPL 2688 Conditions</b>	
<b>Condition</b>	<b>Licence Requirement</b>
Licence Points	1 and 2
Pollutant	Arsenic
	Cadmium
	Calcium
	Conductivity
	Copper
	Lead
	Molybdenum
	Oil and Grease
	pH
	Sulphate
	Total Suspended Solids
	Total Dissolved Solids
	Zinc
Unit of measure	milligrams per litre (mg/L) pH in pH scale
Sampling method	Grab sample
<b>Monitoring frequency</b>	
Point 1	Daily during discharge
Point 2	Daily during discharge
Data reporting	All data reported
<b>Limits</b>	
Point 1 Volume	912 megalitres (ML) per year
Point 2 Discharge	Must not occur unless more than 75 millimetres of rain falls in Broken Hill within the previous three days
Arsenic (As)	0.5 mg/L
Copper (Cu)	0.5 mg/L
Lead (Pb)	0.1 mg/L
Oil and Grease	10 mg/L
pH	6.5-8.5
Total Suspended Solids (TSS)	50 mg/L
Zinc (Zn)	15 mg/L

## Water Quality results

Current Licence reporting period for this parameter is 01-08-2016 to 31-07-2017.

Licence Points 1 and 2 did not discharge during June. No discharge has occurred for the reporting period.

## Blasting

PBHL has four (4) blast monitors associated with the Southern Operations (Figure 6). A summary of EPL 2688 conditions for blasting is provided in Table 7.



**Figure 6.** Location of EPL2688 blast monitors.

**Table 7.** Summary of EPL 2688 conditions for blasting.

<b>Blasting EPL 2688 Conditions</b>	
<b>Condition</b>	<b>Licence Requirement</b>
Licence Points	9B Westside Drive, Broken Hill NSW, 2880. 1A Wentworth Road (Nursing Home), Broken Hill, NSW 2880. Gaffney Street (private residence), Broken Hill, NSW. 53 Rainbow Avenue, Broken Hill, NSW 2880.
Pollutant/s	Ground Vibration
Unit of measure	Millimetres per second (mm/s)
Sampling method	AS 2187.2-2006
Monitoring frequency	All blasts
Data Reporting	All blasts
Date results received	Immediately following each blast
<b>Limits</b>	
Between 2340h to 0630h	Two (2) millimetres per second (mm/s)
Between 2340h to 0630h – duration greater than five seconds	One (1) one millimetre per second (mm/s)
Between 0630h and 2340h – 95% of blasts	Five (5) millimetres per second (mm/s)

## **Blasting Results**

A total of 28 production blasts were conducted during June (Table 8). All blasts were within licence conditions.

**Table 8.** June blast vibration results for EPL 2688.

<b>Licence Point</b>	<b>Parameter (mm/s)</b>	<b>No. times measured in the month</b>	<b>Min. Value</b>	<b>Mean Value</b>	<b>Median Value</b>	<b>Max. Value</b>
Wentworth Road*	Blast Vibration	28	0.350	0.426	0.350	0.794
Rainbow Ave	Blast Vibration	28	0.350	0.545	0.370	1.772
Westside Dr	Blast Vibration	28	0.350	0.593	0.350	2.730
Gaffney St	Blast Vibration	28	0.350	0.623	0.350	3.939

\*Wentworth Road site formally known as Nursing Home

## **Complaints**

There were zero (0) complaints in the month of June for 2017.